






● Supplier : Samsung Electro-Mechanics ● Samsung P/N : CL05B104KO54PND

● AEC-Q200 Qualified

A. Dimension

Dimension

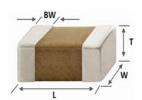

Size	0402 inch
L	1.00±0.05 mm
W	0.50±0.05 mm
Т	0.50±0.05 mm
BW	0.25±0.10 mm

B. Samsung Part Number

<u>CL</u>	<u>05</u>	<u>B</u>	<u>104</u>	<u>K</u>	<u>0</u>	<u>5</u>	<u>4</u>	<u>P</u>	<u>N</u>	<u>D</u>
1	2	3	4	(5)	6	①	8	9	10	11

① Series	Samsung Multi-layer Ceramic Capacitor		
② Size	0402 (inch code)	L: 1.00±0.05 mm	W :0.50±0.05 mm
3 Dielectric	X7R	8 Inner electrode	Ni
Capacitance	100 nF	Termination	Metal-Epoxy
⑤ Capacitance	± 10%	Plating	Sn 100% (Pb Free)
tolerance		9 Product	Automotive
Rated Voltage	16 V	Special code	Normal
① Thickness	0.50±0.05 mm	1 Packaging	Cardboard Type, 13" Reel

C. Reliability Test and Judgement condition

Test items	Performance	Test condition
High Temperature	Appearance : No abnormal exterior appearance	Unpowered, 1,000hrs @ Max. temperature
Exposure	Capacitance Change Within ±10 %	Measurement at 24±2hrs after test conclusion
	Tan δ :0.075 max.	
	IR ∶More than 10,000 MΩ or 500 MΩ×μF	Initial Measurement 2*
	Whichever is smaller	Final Measurement 3*
Temperature Cycling	Appearance : No abnormal exterior appearance	1,000Cycles
	Capacitance Change Within ±10 %	Initial Measurement 2*
	Tan δ :0.075 max.	Final Measurement 3*
	IR : More than 10,000 № or 500 №× <i>µ</i> F	Measurement at 24±2hrs after test conclusion
	Whichever is smaller	1 cycle condition : -55+0/-3 °C (30±3min) → Room Temp. (1min)
		→ 125+3/-0°C (30±3min) → Room Temp. (1min)
Destructive Physical	No Defects or abnormalities	Per EIA 469
Analysis		
Humidity Bias	Appearance : No abnormal exterior appearance	1,000hrs 85℃/85%RH, Rated Voltage and 1.3~1.5V,
	Capacitance Change Within ±12.5 %	Add 100kohm resistor
	Tan δ :0.075 max.	Initial Measurement 2*
	IR ∶More than 500 № or 25 №× <i>µ</i> F	Final Measurement 4*
	Whichever is smaller	Measurement at 24±2hrs after test conclusion
		The charge/discharge current is less than 50mA.
High Temperature	Appearance : No abnormal exterior appearance	1,000hrs @ 125℃, 200% Rated Voltage,
Operating Life	Capacitance Change Within ±12.5 %	Initial Measurement 2*
	Tan δ :0.075 max.	Final Measurement 4*
	IR ∶More than 1,000 MΩ or 50 MΩ×μF	Measurement at 24±2hrs after test conclusion
	Whichever is smaller	The charge/discharge current is less than 50mA.

	Performance			Т	est condition	on				
External Visual	No abnormal exterior appearance	Micros	cope (X10)	1						
Physical Dimension	Within the specified dimensions	Using 7	The caliper	S						
Mechanical Shock	Appearance : No abnormal exterior appearance	Three s	shocks in e	ach direction	on should b	e applied alon	g			
	Capacitance Change Within ±10 %	3 mutu	ally perper	ndicular axe	es of the tes	st specimen (1	8 shocks)			
	Tan δ, IR : Initial spec.	Pe	eak value	Duration	Wave	Velocity				
		1,500G 0.5ms Half sine 4.7m/sec								
		Initial N	Measureme	ent 2*						
		Final M	/leasureme	nt 5*						
Vibration	Appearance : No abnormal exterior appearance	5g's for	r 20min., 1	2cycles ead	ch of 3 orie	ntations,				
	Capacitance Change Within ±10 %	Use 8"	'×5" PCB 0.	.031" Thick	7 secure p	oints on one lo	ong side			
	Tan δ, IR : Initial spec.	and 2 s	secure poir	nts at corne	rs of oppos	site sides. Part	s mounted			
		within 2	2" from any	secure po	int. Test fro	om 10~2,000Hz				
		Initial N	Measureme	ent 2*						
		Final M	/leasureme	nt 5*						
Resistance to	Appearance : No abnormal exterior appearance	prehea	ating : 150°0	C for 60~12	.0 sec.					
Solder Heat	Capacitance Change Within 2 %		pot : 260±							
	Tan δ, IR : Initial spec.	Initial N	Measureme	ent 2*						
		Final M	/leasureme	nt 3*						
ESD	Appearance : No abnormal exterior appearance	AEC-Q	Q200-002 o	r ISO/DIS1	0605					
	Capacitance Change Within %	Initial N	Measureme	ent 2*						
	Tan δ, IR : Initial spec.	Final M	/leasureme	nt 4*						
Solderability	95% of the terminations is to be soldered	a) Preh	heat at 155	°C for 4 ho	urs, Immers	se in solder for	5s at 245±5℃			
	evenly and continuously	b) Stea	am aging fo	r 8 hours, l	mmerse in	solder for 5s a	nt 245±5℃			
		c) Stea	am aging fo	r 8 hours, I	mmerse in	solder for 120	s at 260±5℃			
		solder	: a solution	ethanol ar	nd rosin					
Electrical	Capacitance : Within specified tolerance	*A capa	acitor prior	to measuri	ng the cap	acitance is hea	it treated at			
Characterization	Tan δ :0.05 max.	150 +0)/-10°C for ′	1hour and r	maintained	in ambient air	for 24±2 hours			
	IR(25℃): More than 10,000 № or 500 №× <i>μ</i> F	The Ca	apacitance	/ D.F. shou	ıld be meas	sured at 25℃,				
	Whichever is smaller	1 kHz ±	,	1 ± 0.2 Vrm						
	IR(125℃) More than 1,000 № or 10 № × <i>μ</i> F					age not exceed	ding			
	Whichever is smaller	Rated \	Voltage @:	25℃, @12	5℃ for 60	~120 sec.				
	Dielectric Strength	Dielect	tric Strengt	h : 250% of	the rated v	voltage for 1~5	seconds			
Board Flex	Appearance : No abnormal exterior appearance	Bendin	ng to the lim	nit, mm for	60 seconds	s 1*				
	Capacitance Change Within %	Initial N	Measureme	ent 2*						
		Final M	/leasureme	nt 5*						
Terminal	Appearance : No abnormal exterior appearance	N, for	60 sec.							
Strength(SMD)	Capacitance Change Within %	Initial N	Measureme	ent 2*						
		Final Measurement 5*								
Beam Load	Destruction value should be exceed N	Beam s	speed :	mm/sec						
Temperature	X7R									
Characteristics	From -55 $^{\circ}$ C to 125 $^{\circ}$ C, Capacitance change shou	d be wit	thin ±15%							

D. Recommended Soldering method :

Reflow (Reflow Peak Temperature : 260 +0/-5°C, 30sec.), Meet IPC/JEDEC J-STD-020 D Standard

- *1 : The figure indicates typical specification. Please refer to individual specifications.
- *2 : Initial measurement : Perform a heat treatment at 150 +0/-10 $^{\circ}\mathrm{C}$ for one hour after soldering process. and then let sit for 24±2 hours at room temperature. Perform the initial measurement.
- $^{\star}3: Final\ measurement: Let\ sit\ for\ 24\pm2\ hours\ at\ room\ temperature\ after\ test\ conclusion,\ then\ measure.$
- *4 : Final measurement : Perform a heat treatment at 150 +0/-10 °C for one hour after soldering process. and then let sit for 24±2 hours at room temperature. Perform the initial measurement.
- *5 : Final measurement : Let measure within 24 hours at room temperature after test conclusion.

Product specifications included in the specifications are effective as of March 1, 2013.


Please be advised that they are standard product specifications for reference only.

We may change, modify or discontinue the product specifications without notice at any time.

So, you need to approve the product specifications before placing an order.


Should you have any question regarding the product specifications, please contact our sales personnel or application engineers.


E. Recommended TEST PCB

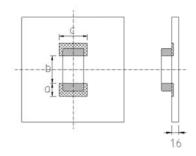

(Adhesive strength of termination)

(nesire sareingan er		,	
Size code	Size (mm)	а	b	С
02	0.4 × 0.2	0.20	0.17	0.26
03	0.6 × 0.3	0.30	0.30	0.30
05	1.0. × 0.5	0.40	0.55	0.50
10	1.6 × 0.8	1.00	1.00	1.20
21	2.0 × 1.25	1.20	1.40	1.65
31	3.2 × 1.6	2.20	1.40	2.00
32	3.2 × 2.5	2.20	1.40	2.90
43	4.5 × 3.2	3.50	1.75	3.70
55	5.7 × 5.0	4.50	1.75	5.60

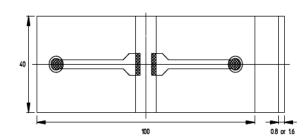

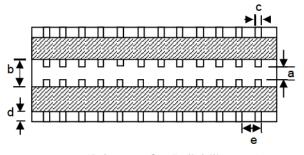

(Substrate for bending strength test)

(Substrate for Reliability test)

ioi is airiairig air	(Substitute for In										
Size code	Size (mm)	а	b	С	d	е					
02	0.4 × 0.2	0.2	0.6	0.2	5.0	5.5					
03	0.6 × 0.3	0.3	0.9	0.3	5.0	5.5					
05	1.0 × 0.5	0.4	1.5	0.5	5.0	5.5					
10	10 1.6 × 0.8		3.0	1.2	5.0	5.5					
21	2.0 × 1.25	1.2	4.0	1.65	5.0	5.5					
31	3.2 × 1.6	2.2	5.0	2.0	5.0	5.5					
32	3.2 × 2.5	2.2	5.0	2.9	5.0	5.5					
43	43 4.5 × 3.2		7.0	3.7	5.0	5.5					
55	5.7 × 5.0	4.5	8.0	5.6	5.0	5.5					

☞ Caution : Abnormality can occur if lead-based solder (KSD 6704) with 3% silver is used.




1. Packaging

This specification applies to taping of MLCC

When customers require, the specification may be changed under the agreement.

1-1. Figure

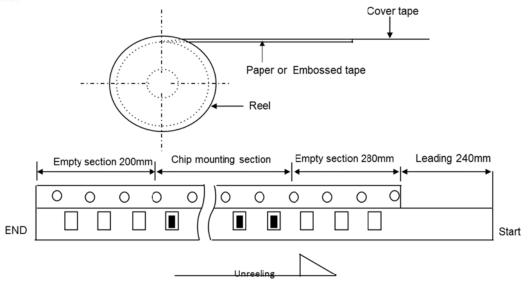

1-2. Quantity


[unit:pcs]

Туре	Size Code Inch(mm)	Chip Thickness	Taping Type	Pitch	Plastic 7 inches reel	Plastic 10 inches reel	Plastic 13 inches reel
	0402 (01005)	0.2 mm	PAPER	2mm	20k	-	100K
	0603 (0201)	0.3 mm	PAPER	2mm	10K	-	50K
	1005 (0402)	0.5 mm	PAPER	2mm	10K	-	50K
	1608 (0603)	0.8 mm	PAPER	4mm	4K	10K	15K / 10K
	2012 (0005)	T≤0.85 mm	PAPER	4mm	4K	10K	15K / 10K
	2012 (0805)	T≥1.0 mm	EMBOSSED	4mm	2K	6K	10K
	2216 (1206)	T≤0.85 mm	PAPER	4mm	4K	10K	10K
MLCC	3216 (1206)	T≥1.0 mm	EMBOSSED	4mm	2K	4K	10K
	2225 (1210)	T≤1.6 mm	EMBOSSED	4mm	2K	4K	10K
	3225 (1210)	T≥2.0 mm	EMBOSSED	4mm	1K	4K	4K
	4500 (1000)	T≤1.6 mm	EMBOSSED	8mm	2k	-	8k
	4520 (1808)	T≥2.0 mm	EMBOSSED	8mm	1k	-	4k
	4522 (1012)	T≤2.0 mm	EMBOSSED	8mm	-	-	4K
	4532 (1812)	T>2.0 mm	EMBOSSED	8mm	-	-	2K
	5750 (2220)	T≥2.5 mm	EMBOSSED	8mm	-	-	2K



1-3. Tape Size

1-3-1. Cardboard(Paper) tape: 4mm pitch

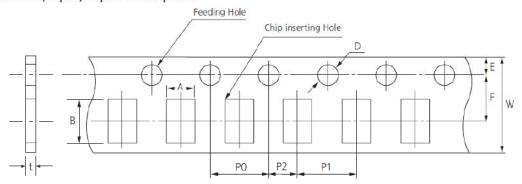


[unit:mm]

Size Inch(mm)	Α	В	w	F	E	P1	P2	P0	D	t
0603	1.00	1.90								
(1608)	±0.10	±0.10								
0805	1.55	2.30	8.00	3.50	1.75	4.00	2.00	4.00	φ1.50	1.1
(2012)	±0.10	±0.10	±0.30	±0.05	±0.10	±0.10	±0.05	±0.10	+0.10/-0	Below
1206	2.05	3.60								
(3216)	±0.10	±0.10								

** The A, B in the table above are based on normal dimensions. The data may be changed with the special size tolerances.

1-3-2. Cardboard(Paper) tape: 2mm pitch

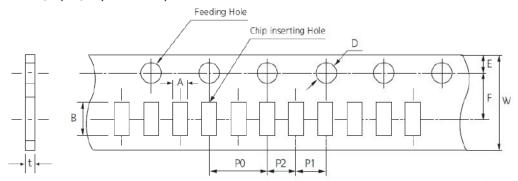


[unit:mm]

Size Inch(mm)	Α	В	w	F	E	P1	P2	P0	D	t
01005	0.25	0.46								0.25
(0402)	±0.02	±0.02								±0.02
0201	0.38	0.68								0.35
(0603)	±0.03	±0.03	8.00	3.50	1.75	2.00	2.00	4.00 ± 0.10	ф 1.50	±0.03
0402	0.62	1.12	± 0.30		±0.10	± 0.05	± 0.05		+0.10	0.60
(1005)	±0.05	±0.05	⊥0.50	±0.05	1.10	1 0.03	1 0.03		/-0.03	±0.05
0204	0.62	1.12								0.37
	+0.05	+0.05								±0.03
(0510)	/-0.10	/-0.10								±0.03



1-3-3. Embossed(Plastic) tape

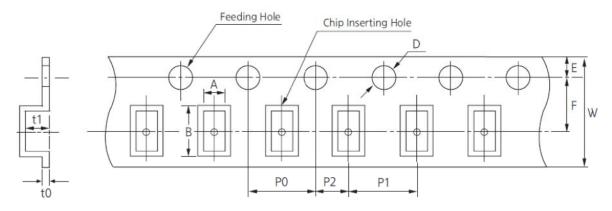


[unit:mm]

Size Inch(mm)	A	В	w	F	E	P1	P2	PO	D	t1	t0
01005 (0402)	0.23 ±0.02	0.45 ±0.02	4.00 ±0.05	1.80 ±0.02	0.90 ±0.05	1.00 ±0.02	1.00 ±0.02	2.00 ±0.03	φ0.80 ±0.04	0.35	0.50
015008 (05025)	0.32 ±0.03	0.58 ±0.03				2.00 ±0.05			φ1.50 +0.10 /-0.03	Below	Below
0603 (1608)	1.05 ±0.15	1.90 ±0.15									
0805 (2012)	1.45 ±0.20	2.30 ±0.20	8.00 ±0.30	3.50 ±0.05		4.00 ±0.10			φ1.50 +0.10 /-0	2.50	
1206 (3216)	1.90 ±0.20	3.50 ±0.20								Below	
1210 (3225)	2.80 ±0.20	3.60 ±0.20			1.75		2.00	4.00			
1808 (4520)	2.30 ±0.20	4.90 ±0.20			±0.10		±0.05 ±0.10	±0.10			0.60 Below
1812 (4532)	3.60 ±0.20	4.90 ±0.20	12.0 ±0.30	5.60 ±0.05		8.00 ±0.10				3.80 Below	
2220 (5750)	5.50 ±0.20	6.20 ±0.20									
0204 (0510)	0.62 +0.05 /-0.10	1.12 +0.05 /-0.10	8.00	3.50		4.00				2.50	
0306 (0816)	1.10 ±0.20	1.90 ±0.20	±0.30	±0.05		±0.10				Below	

X The A, B in the table above are based on normal dimensions. The data may be changed with the special size tolerances.



1-3-4. Reel Size

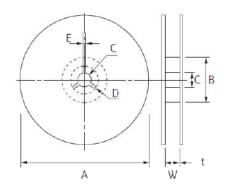

[unit:mm]


Symbol	Tape Width	Α	В	С	D	E	W	t
	4mm	φ178±2.0	MIN φ 50	φ13±0.5	21 ± 0.8	2.0±0.5	5±0.5	1.2±0.2
7"Reel	8mm	ф178±2.0	MIN φ 50	ϕ 13 ± 0.5	21 ± 0.8	2.0 ± 0.5	10±1.5	0.9±0.2
	12mm	φ178±2.0	MIN φ 50	φ13±0.5	21±0.8	2.0±0.5	13±0.5	1.2±0.2
10"Reel	8mm	ф258±2.0	MIN φ 70	φ13±0.5	21 ± 0.8	2.0 ± 0.5	10±1.5	1.8 ± 0.2
12"Daal	8mm	ф330±2.0	MIN φ 70	φ13±0.5	21±0.8	2.0±0.5	10±1.5	1.8 ± 0.2
13"Reel	12mm	ф330±2.0	MIN φ 70	φ13±0.5	21±0.8	2.0±0.5	13±0.5	2.2±0.2

1-4. Cover tape peel-off force

1-4-1. Peel-off force

10 g.f \leq peel-off force \leq 70 g.f

1-4-2. Measurement Method

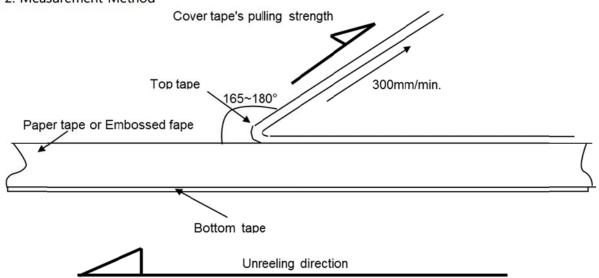

- -Taping Packaging design : Packaging design follows IEC 60286-3 standard. (IEC 60286-3 Packaging of components for automatic handling parts 3)
- * If the static electricity of SMT process causes any problems, please contact us.




1-5. BOX package

1-5-1. Packaging Label

REEL & Box Type

Label includes the information as below.

- 1) Chip size
- 2) Temperature Characteristics
- 3) Nominal Capacitance
- 4) Model Name
- 5) LOT Number & Reel Number
- 6) Q'ty

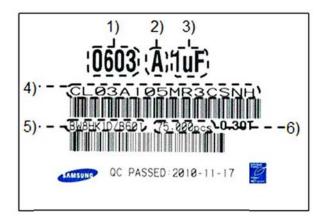


1-5-2. Box Packaging

- 1) Double packaging with the paper type of inner box and outer box.
- 2) Avoid any damages during transportation by car, airplane and ship.
- 3) Remark information of contents on inner box and outer box
- * If special packaging is required, please contact us.


1-5-3. 7" Box packaging

- Inner Box (7" x 5 REEL)

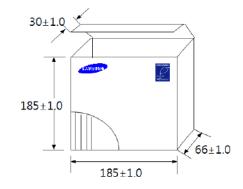


[Unit : mm]


- Inner Box (7" x 10 REEL)

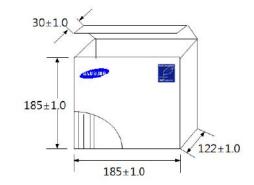

- Outer Box (7" x 20 REEL)

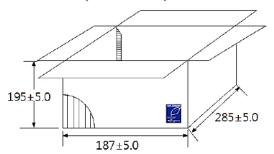


- Outer Box (7" x 60 REEL)

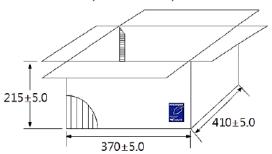





1-5-4. 13" Box packaging

- Inner Box (13" x 4 REEL)

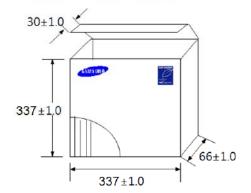



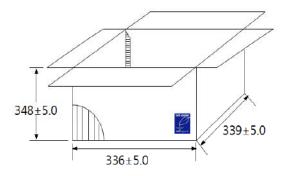

1-6. Chip Weight

Size(L/W) Inch(mm)	Size(T) (mm)	Temp.	Weight (mg/pc)	Size(L/W) Inch(mm)	Size(T) (mm)	Temp.	Weight (mg/pc)
24.22	0.20	C0G	0.082	0004	0.30	C0G	0.233
01005	0.20	X7R	0.083	0201	0.30	X7R	0.285
(0402)	0.20	X5R	0.093	(0603)	0.30	X5R	0.317
0402	0.50	C0G	1.182	0603 (1608)	0.80	C0G	4.615
(1005)	0.50	X7R	1.559		0.80	X7R	5.522
(1005)	0.50	X5R	1.560		0.80	X5R	5.932
0005	0.65	C0G	7.192	1200	1.25	C0G	28.086
0805	1.25	X7R	16.523	1206	1.60	X7R	54.050
(2012)	1.25	X5R	16.408	(3216)	1.60	X5R	45.600
1210	2.50	X7R	116.197	1808	1.25	C0G	47.382
(3225)	2.50	X5R	121.253	(4520)	1.25	X7R	63.136
1812	1.25	X7R	96 697	2220 (5750)	1.60	X7R	260.897
(4532)	1.25	A/K	96.697		1.60	A/K	200.897

The weight of product is typical value per size, for more details, please contact us.



2. Product Characteristic data

2-1. Capacitance

The capacitance is the ratio of the change in an electric charge according to voltage change. Due to the fact that the capacitance may be subject to change with the measured voltage and frequency, it is highly recommended to measure the capacitance based on the following conditions.

2-1-1. Measure capacitance with voltage and frequency specified in this document.

Regarding the voltage/frequency condition for capacitance measurement of each MLCC model, please make sure to follow a section "C. Reliability test Condition - Capacitance" in this document.

The following table shows the voltage and frequency condition according to the capacitance range.

[The voltage and frequency condition according to MLCC the capacitance range]

Class I

Capacitance	Frequency	Voltage	
≤ 1,000 pF	1 MHz ± 10%	0.5 ~ 5 Vrms	
> 1,000 pF	1 kHz ± 10%	0.5 ~ 5 Vrms	

Class II

Capacitance	Frequency	Voltage	
≤ 10 µF	1 kHz ± 10%	1.0 ± 0.2 Vrms	
> 10 µF	120 Hz ± 20%	0.5 ± 0.1 Vrms	
Exception*	1 kHz ± 10%	0.5 ± 0.1 Vrms	

Capacitance shall be measured after the heat treatment of 150+0/-10°C for 1hr, leaving at room temperature for 24±2hr. (Class II)

2-1-2. It is recommended to use measurement equipment with the ALC (Auto Level Control) option. The reason is that when capacitance or measurement frequency is high, the output voltage of measurement equipment can be lower than the setting voltage due to the equipment limitation. Note that when capacitance or measurement frequency is excessively high, the measurement equipment may show ALC off warning and provide a lower output voltage than the setting voltage even with ALC option selected. It is necessary to ensure the output voltage of measurement equipment is the same as the setting voltage before measuring capacitance.



- 2-1-3. Capacitance value of high dielectric constant (Class II) MLCC changes with applied AC and DC voltage. Therefore, it is necessary to take into account MLCC's AC voltage characteristics and DC-bias voltage characteristics when applying MLCC to the actual circuit.
- 2-1-4. The capacitance is in compliance with the EIA RS-198-1-F-2002.

2-2. Tan δ (DF)

- 2-2-1. An ideal MLCC's energy loss is zero, but real MLCC has dielectric loss and resistance loss of electrode. DF (Dissipation Factor) is defined as the ratio of loss energy to stored energy and typically being calculated as percentage.
- 2-2-2. Quality factor (Q factor) is defined as the ratio of stored energy to loss energy.

 The equation can be described as 1/DF. Normally the loss characteristic of Class I MLCC is presented in Q, since the DF value is so small whereas the loss characteristic of Class II MLCC is presented in DF.
- 2-2-3. It is recommended to use Class I MLCC for applications to require good linearity and low loss such as coupling circuit, filter circuit and time constant circuit.

2-3. Insulation Resistance

Ceramic dielectric has a low leakage current with DC voltage due to the high insulating properties. Insulation resistance is defined as the ratio of a leakage current to DC voltage.


2-3-1. When applying DC voltage to MLCC, a charging current and a leakage current flow together at the initial stage of measurement. While the charging current decreases, and insulation resistance (IR) in MLCC is saturated by time. Therefore, insulation resistance shall be measured 1 minute after applying the rated voltage.

2-4. Capacitance Aging

The aging characteristic is that the high dielectric (Class II) MLCC decreases capacitance value over time. It is also necessary to consider the aging characteristic with voltage and temperature characteristics when Class II MLCC is used in circuitry.



- 2-4-1. In general, aging causes capacitance to decrease linearly with the log of time as shown in the following graph. Please check with SEMCO for more details, since the value may vary between different models.
- 2-4-2. After heat treatment (150 °C, 1hour), the capacitance decreased by aging is recovered, so aging should be considered again from the time of heat treatment.

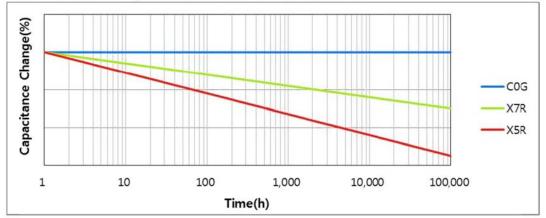


[Example of Capacitance Aging]

* Sample: COG, X7R, X5R

2-5. Temperature Characteristics of Capacitance (TCC)


Please consider temperature characteristics of capacitance since the electrical characteristics such as capacitance changes which is caused by a change in ceramic dielectric constant by temperature.

2-5-1. It is necessary to check the values specified in section "C. Reliability test Condition–Temperature Characteristics" for the temperature and capacitance change range of MLCC.

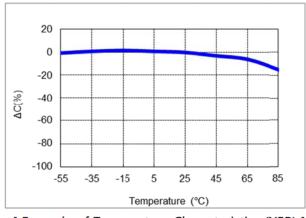



* Sample: 10uF, Rated voltage 6.3V

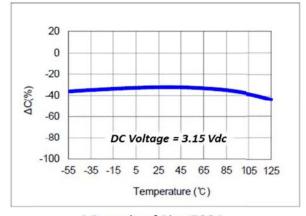

[Example of Bias TCC]

* Sample : 10uF, Rated voltage 6.3V




- 2-5-2. When selecting MLCC, it is necessary to consider the heat characteristics of a system, room temperature and TCC of MLCC, since the applied temperature may change the capacitance of MLCC.
- 2-5-3. In addition, Bias TCC of MLCC should be taken into account when DC voltage is applied to MLCC.

2-6. Self-heating Temperature

It is necessary to design the system, with considering self-heating generated by the ESR (Equivalent Series Resistance) of MLCC when AC voltage or pulse voltage is applied to MLCC.

- 2-6-1. When MLCC is used in an AC voltage or pulse voltage circuit, self-heating is generated when AC or pulse current flows through MLCC. Short-circuit may be occurred by the degradation of MLCC's insulating properties.
- 2-6-2. The reliability of MLCC may be affected by MLCC being used in an AC voltage or pulse voltage circuit, even the AC voltage or the pulse voltage is within the range of rated voltage.

 Therefore, make sure to check the following conditions.
 - 1) The surface temperature of MLCC must stay within the maximum operating temperature after AC or Pulse voltage is applied.
 - 2) The rise in increase by self-heating of MLCC must not exceed 20°C

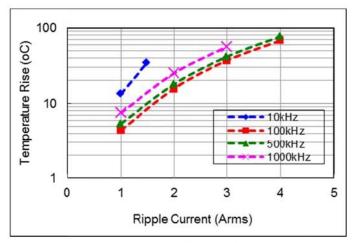

[Example of Ripple current]


* Sample : X5R 10uF, Rated voltage 6.3V



2-7. DC & AC Voltage Characteristics

It is required to consider voltage characteristics in the circuit since the capacitance value of high dielectric constant MLCC(Class II) is changed by applied DC & AC voltage.


2-7-1. Please ensure the capacitance change is within the allowed operating range of a system. In particular, when high dielectric constant type MLCC (Class II) is used in circuit with narrow allowed capacitance tolerance, a system should be designed with considering DC voltage, temperature characteristics and aging characteristics of MLCC.

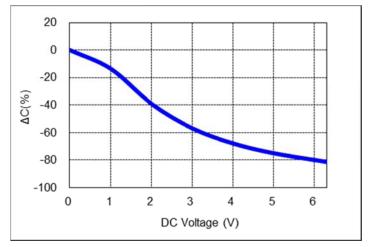

[Example of DC Bias characteristics]

* Sample : X5R 10uF, Rated voltage 6.3V

2-7-2. It is necessary to consider the AC voltage characteristics of MLCC and the AC voltage of a system, since the capacitance value of high dielectric constant type MLCC (Class II) varies with the applied AC voltage.

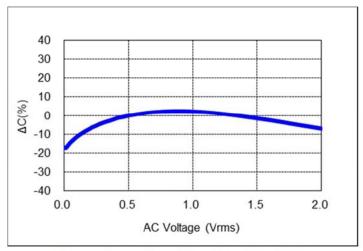

[Example of AC voltage characteristics]

* Sample: X5R 10uF, Rated voltage 6.3V




2-8. Impedance Characteristic

Electrical impedance (Z) of MLCC is the measurement of the opposition that MLCC presents to a current (I) when a voltage (V) is applied. It is defined as the ratio of the voltage to the current (Z=V/I). Impedance extends the concept of resistance to AC circuits and is a complex number consisting of the real part of resistance (R) and the imaginary part of reactance (X) as Z=R+jX. Therefore, it is required to design circuit with consideration of the impedance characteristics of MLCC based on the frequency (Z=R+jX)

- 2-8-1. MLCC operates as a capacitor in the low frequency and its reactance (XC) decreases as frequency increases (X_C=1/j2πfC) where f is frequency and C is capacitance.

 The resistance (ESR; Equivalent Series Resistance) of MLCC in the low frequency mainly comes from the loss of its dielectric material.
- 2-8-2. MLCC operates as an inductor in the high frequency and the inductance of MLCC is called ESL (Equivalent Series Inductance). The reactance (XL) of MLCC in the high frequency increases as frequency increases ($X_L=j2\pi f\cdot ESL$). The resistance (ESR) of MLCC in the high frequency mainly comes from the loss of its electrode metal.
- 2-8-3. SRF (Self Resonant Frequency) of MLCC is the frequency where its capacitive reactance (XC) and inductive reactance(XL) cancel each other and the impedance of MLCC has only ESR at SRF.
- 2-8-4. The impedance of MLCC can be measured by a network analyzer or an impedance analyzer. When using the network analyzer, please note that the small-signal input may lead to the impedance of low capacitance caused by the AC voltage characteristic of MLCC.

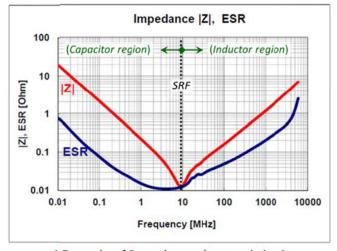

[Example of Impedance characteristics]

* Sample : X5R 1uF, Rated voltage 6.3V




3. Electrical & Mechanical Caution

3-1. Derating

MLCC with the test voltage at 100% of the rated voltage in the high temperature resistance test are labeled as "derated MLCC." For this type of MLCC, the voltage and temperature should be derated as shown in the following graph for the equivalent life time of a normal MLCC with the test voltage at 150% of the rated voltage in the high temperature resistance test.

- 3-1-1. The derated MLCC should be applied with the derating voltage and temperature as shown in the following graph.
- 3-1-2. The "Temperature of MLCC" in the x-axis of the graph below indicates the surface temperature of MLCC including self-heating effect. The "Voltage Derating Ratio" in the y-axis of the graph below gives the maximum operating voltage of MLCC with reference to the maximum voltage (Vmax) as defined in section "3-2. Applied Voltage."

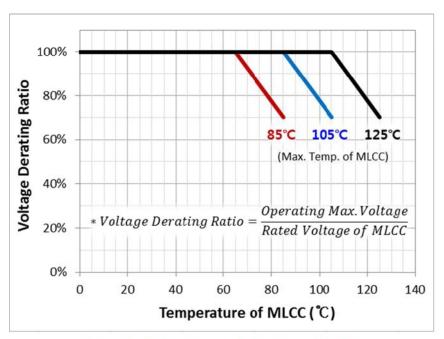

[Example of derating graph for derated MLCC]

- * Vmax ≤ Derated Voltage
- * Only the Derating marked models



3-2. Applied Voltage

The actual applied voltage on MLCC should not exceed the rated voltage set in the specifications. 3-2-1. Cautions by types of voltage applied to MLCC

- For DC voltage or DC+AC voltage, DC voltage or the maximum value of DC + AC voltage should not exceed the rated voltage of MLCC.
- · For AC voltage or pulse voltage, the peak-to-peak value of AC voltage or pulse voltage should not exceed the rated voltage of MLCC.
- · Abnormal voltage such as surge voltage, static electricity should not exceed the rated voltage of MLCC.

DC Voltage AC Voltage DC+AC Voltage 1 DC+AC Voltage 2 DC+Pulse Voltage

| DC Voltage | DC+AC Voltage 2 DC+Pulse Voltage | DC+Pu

[Types of Voltage Applied to the Capacitor]

3-2-2. Effect of EOS (Electrical Overstress)

- Electrical Overstress such as a surge voltage or EOS can cause damages to MLCC, resulting in the electrical short failure caused by the dielectric breakdown in MLCC.
- · Down time of MLCC is varied with the applied voltage and the room temperature and a dielectric shock caused by EOS can accelerate heating on the dielectric. Therefore, it can bring about a failure of MLCC in a market at the early stage.
- · Please use caution not to apply excessive electrical overstress including spike voltage MLCC when preparing MLCC for testing or evaluating.

(1) Surge


When the overcurrent caused by surge is applied to MLCC, the influx of current into MLCC can induce the overshooting phenomenon of voltage as shown in the graph below and result in the electrical short failure in MLCC. Therefore, it is necessary to be careful to prevent the influx of surge current into MLCC.


(2) ESD (Electrostatic Discharge)

Since the voltage of the static electricity is very high but the quantity of electric charge is small compared to the surge, ESD can cause damage to MLCC with low capacitance as shown in the



following graph, whereas surge with lots of electric charge quantity can cause damages to even high capacitance MLCC.

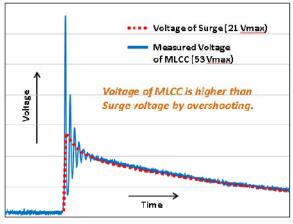

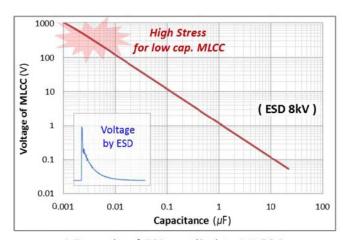

[Example of Surge applied to MLCC]

[Example of ESD applied to MLCC]

* Simulation for ESD 8kV

3-3. Vibration

Please check the types of vibration and shock, and the status of resonance.

Manage MLCC not to generate resonance and avoid any kind of impact to terminals.

When MLCC is used in a vibration environment, please make sure to contact us for the situation and consider special MLCC such as Soft-term, etc.

3-4. Shock

Mechanical stress caused by a drop may cause damages to a dielectric or a crack in MLCC Do not use a dropped MLCC to avoid any quality and reliability deterioration.

When piling up or handling printed circuit boards, do not hit MLCC with the corners of a PCB to prevent cracks or any other damages to the MLCC.

3-5. Piezo-electric Phenomenon

MLCC may generate a noise due to vibration at specific frequency when using the high dielectric constant MLCC (Class II) at AC or Pulse circuits.

MLCC may cause a noise if MLCC is affected by any mechanical vibrations or shocks.




4. Process of Mounting and Soldering

4-1. Mounting


4-1-1. Mounting position

It is recommended to locate the major axis of MLCC in parallel to the direction in which the stress is applied.

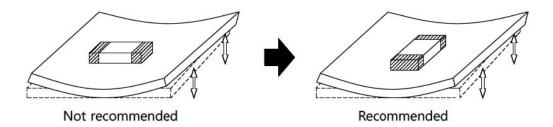


4-1-2. Cautions during mounting near the cutout

Please take the following measures to effectively reduce the stress generated from the cutting of PCB. Select the mounting location shown below, since the mechanical stress is affected by a location and a direction of MLCC mounted near the cutting line.

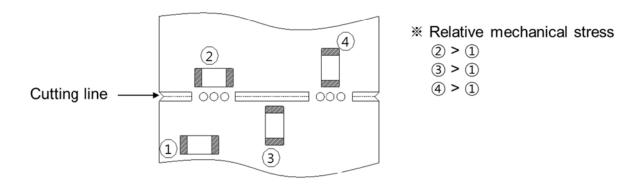

4-1-3. Cautions during mounting near screw

If MLCC is mounted near a screw hole, the board deflection may be occurred by screw torque. Mount MLCC as far from the screw holes as possible.

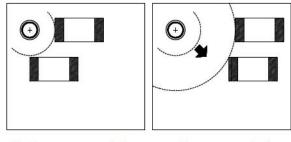

Not recommended

Recommended



4-2. Caution before Mounting

- 4-2-1. It is recommended to store and use MLCC in a reel. Do not re-use MLCC that was isolated from the reel.
- 4-2-2. Check the capacitance characteristics under actual applied voltage.
- 4-2-3. Check the mechanical stress when actual process and equipment is in use.
- 4-2-4. Check the rated capacitance, rated voltage and other electrical characteristics before assembly. Heat treatment must be done prior to measurement of capacitance.
- 4-2-5. Check the solderability of MLCC that has passed shelf life before use.
- 4-2-6. The use of Sn-Zn based solder may deteriorate the reliability of MLCC.

4-3. Cautions during Mounting with Mounting (pick-and-place) Machines


4-3-1. Mounting Head Pressure

Excessive pressure may cause cracks in MLCC.

It is recommended to adjust the nozzle pressure within the maximum value of 300g.f. Additional conditions must be set for both thin film and special purpose MLCC.

4-3-2. Bending Stress

When using a two-sided substrate, it is required to mount MLCC on one side first before mounting on the other side due to the bending of the substrate caused by the mounting head. Support the substrate as shown in the picture below when MLCC is mounted on the other side. If the substrate is not supported, bending of the substrate may cause cracks in MLCC.

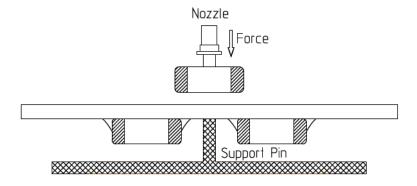

4-3-3. Suction nozzle

Dust accumulated in a suction nozzle and suction mechanism can impede a smooth movement of the nozzle. This may cause cracks in MLCC due to the excessive force during mounting.

If the mounting claw is worn out, it may cause cracks in MLCC due to the uneven force during positioning.

A regular inspection such as maintenance, monitor and replacement for the suction nozzle and mounting claw should be conducted.



4-4. Reflow soldering


MLCC is in a direct contact with the dissolved solder during soldering, which may be exposed to potential mechanical stress caused by the sudden temperature change.

Therefore, MLCC may be contaminated by the location movement and flux.

For the reason, the mounting process must be closely monitored.

Met	Classification	
		Infrared rays
	Overall heating	Hot plate
Doflow coldering		VPS(Vapor phase)
Reflow soldering		Air heater
	Local heating	Laser
		Light beam

4-4-1. Reflow Profile

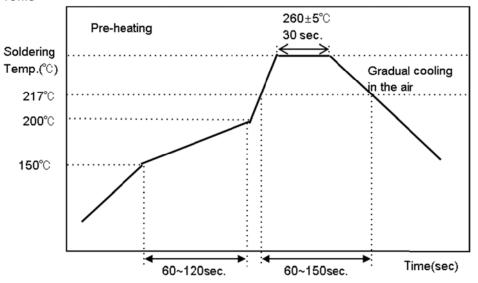

[Reflow Soldering Conditions]

Use caution not to exceed the peak temperature (260°C) and time (30sec) as shown. Pre-heating is necessary for all constituents including the PCB to prevent the mechanical damages on MLCC. The temperature difference between the PCB and the component surface must be kept to the minimum.

As for reflow soldering, it is recommended to keep the number of reflow soldering to less than three times. Please check with us when the number of reflow soldering needs to exceed three times. Care must be exercised especially for the ultra-small size, thin film and high capacitance MLCC as they can be affected by thermal stress more easily.



4-4-2. Reflow temperature

The following quality problem may occur when MLCC is mounted with a lower temperature than the reflow temperature recommended by a solder manufacturer. The specified peak temperature must be maintained after taking into consideration the factors such as the placement of peripheral constituent and the reflow temperature.


- ·Drop in solder wettability
- ·Solder voids
- ·Potential occurrence of whisker
- ·Drop in adhesive strength
- ·Drop in self-alignment properties
- ·Potential occurrence of tombstones

4-4-3. Cooling

Natural cooling with air is recommended.

4-4-4. Optimum solder flux for reflow soldering

- Overly the thick application of solder pastes results in an excessive solder fillet height.
 This makes MLCC more vulnerable to the mechanical and thermal stress from the board, which may cause cracks in MLCC.
- · Too little solder paste results in a lack of the adhesive strength, which may cause MLCC to isolate from PCB
- · Check if solder has been applied uniformly after soldering is completed.



Too Much Solder large stress may cause cracks




Not enough solder
Weak holding force may cause bad
connections or detaching of the capacitor

- · It is required to design a PCB with consideration of a solder land pattern and its size to apply an appropriate amount of solder to MLCC. The amount of the solder at the edge may impact directly on cracks in MLCC.
- The design of a suitable solder land is necessary since the more the solder amount is, the larger the force MLCC experiences and the higher the chance MLCC cracks.



4-5. Flow soldering

4-5-1. Flow profile

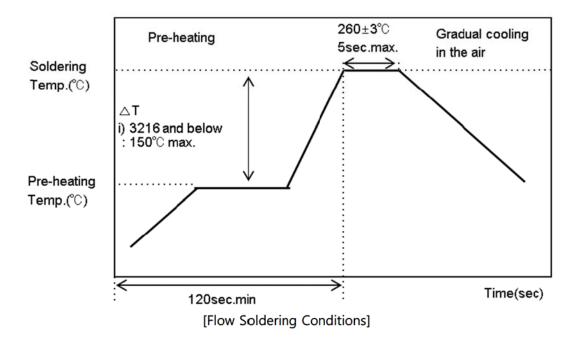

Take caution not to exceed peak temperature (260°C) and time (5sec) as shown. In case of flow soldering, only 1608(0603inch), 2012(0805inch), 3216(1206inch) case size are recommended to use.

Please contact us before use the type of high capacitance and thin film MLCC for some exceptions that may be caused.

4-5-2. Caution before Flow soldering

- · When a sudden heat is applied to MLCC, the mechanical rigidity of MLCC is deteriorated by the internal deformation of MLCC. Preheating all the constituents including PCB is required to prevent the mechanical damages on MLCC. The temperature difference between the solder and the surface of MLCC must be kept to the minimum.
- · If the flow time is too long or the flow temperature is too high, the adhesive strength with PCB may be deteriorated by the leaching phenomenon of the outer termination, or the capacitance value may be dropped by weak adhesion between the internal termination and the outer termination.



4-6. Soldering Iron

Manual soldering can pose a great risk on creating thermal cracks in MLCC. The high temperature soldering iron tip may come into a direct contact with the ceramic body of MLCC due to the carelessness of an operator. Therefore, the soldering iron must be handled carefully, and close attention must be paid to the selection of the soldering iron tip and to temperature control of the tip.

4-6-1. How to use a soldering Iron

- · In order to minimize damages on MLCC, preheating MLCC and PCB is necessary.

 A hot plate and a hot air type preheater should be used for preheating
- . Do not cool down MLCC and PCB rapidly after soldering.
- · Keep the contact time between the outer termination of MLCC and the soldering iron as short as possible. Long soldering time may cause problems such as adhesion deterioration by the leaching phenomenon of the outer termination.

Variation of	Soldering	Pre-heating	Soldering	Cooling
Temp.	Temp.(°C)	Time(sec)	Time(sec)	Time(sec)
$\Delta T \leq 130$	300±10°C max	≥60	≤4	~=

^{*} Control Δ T in the solder iron and preheating temperature.

Condition of Iron facilities						
Wattage Tip diameter Soldering time						
20W max	3 mm max	4sec max				

^{*} Caution - Iron tip should not contact with ceramic body directly Lead-free solder: Sn-3.0Aq-0.5CU

4-6-2. How to use a spot heater


Compared to local heating using a solder iron, heat by a spot heater heats the overall MLCC and the PCB, which is likely to lessen the thermal shocks.

For a high density PCB, a spot heater can prevent the problem to connect between a solder iron and MLCC directly.

- · If the distance from the air nozzle outlet to MLCC is too close, MLCC may be cracked due to the thermal stress. Follow the conditions set in the table below to prevent this problem.
- · The spot heater application angle as shown in the figure is recommended to create a suitable solder fillet shape.




Distance	5 mm ≤
Hot Air Application angle	45℃
Hot Air Temperature Nozzle Outlet	400℃ ≥
Application Time	10s >

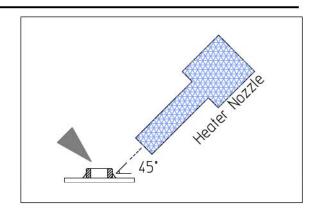

4-6-3. Cautions for re-work

- · Too much solder amount will increase the risk of PCB bending or cause other damages.
- · Too little solder amount will result in MLCC breaking loose from the PCB due to the inadequate adhesive strength.
- · Check if the solder has been applied properly and ensure the solder fillet has a proper shape.

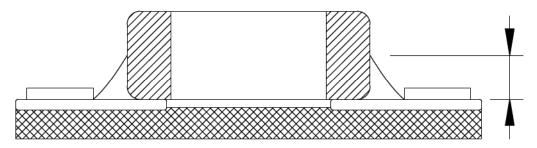

* Soldering wire below ø0.5mm is required for soldering.

4-7. Cleaning

4-7-1. In general, cleaning is unnecessary if rosin flux is used.

When acidic flux is used strongly, chlorine in the flux may dissolve into some types of cleaning fluids, thereby affecting the performance of MLCC.

This means that the cleansing solution must be carefully selected and should always be new.


4-7-2. Cautions for cleaning

MLCC or solder joint may be cracked with the vibration of PCB, if ultrasonic vibration is too strong during cleaning. When high pressure cleaning equipment is used, test should be done for the cleaning equipment and its process before the cleaning in order to avoid damages on MLCC.




4-8. Cautions for using electrical measuring probes

- · Confirm the position of the support pin or jig when checking the electrical performance of MLCC after mounting on the PCB.
- · Watch for PCB bending caused by the pressure of a test-probe or other equipment.
- · If the PCB is bent by the force from the test probe, MLCC may be cracked or the solder joint may be damaged.
- · Avoid PCB flexing by using the support pin on the back side of the PCB.
- · Place equipment with the support pin as close to the test-probe as possible.
- · Prevent shock vibrations of the board when the test-probe contacts a PCB.

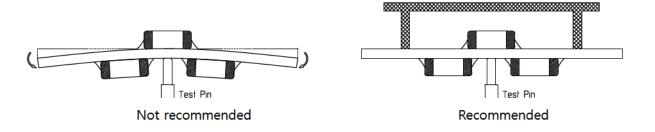

4-9. Printed Circuit Board Cropping

- · Do not apply any stress to MLCC such as bending or twisting the board after mounting MLCC on the PCB.
- · The stress as shown may cause cracks in MLCC when cutting the board.
- · Cracked MLCC may cause degradation to the insulation resistance, thereby causing short circuit.
- · Avoid these types of stresses applied to MLCC.

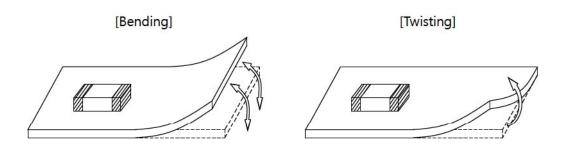

4-9-1. Cautions for cutting PCB

Check a cutting method of PCB in advance.

The high density board is separated into many individual boards after the completion of soldering. If the board is bent or deformed during separation, MLCC may be cracked.

Carefully select a separation method that minimizes the deformation of the PCB.



4-10. Assembly Handling

4-10-1. Cautions for PCB handling

Hold the edges of the board mounted with MLCC with both hands since holding with one hand may bend the board.


Do not use dropped boards, which may degrade the quality of MLCC.

4-10-2. Mounting other components

Pay attention to the following conditions when mounting other components on the back side of The board after MLCC has been mounted on the front side.

When the suction nozzle is placed too close to the board, board deflection stress may be applied to MLCC on the back side, resulting in cracks in MLCC.

Check if proper value is set on each chip mounter for a suction location, a mounting gap and a suction gap by the thickness of components.

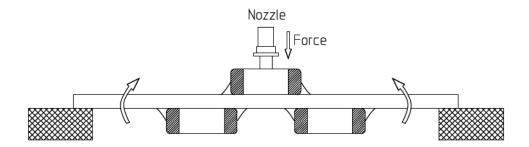


4-10-3. Board mounting components with leads

If the board is bent when inserting components (transformer, IC, etc.) into it, MLCC or solder joint may be cracked.

Pay attention to the following:


- · Reduce the stress on the board during insertion by increasing the size of the lead insertion hole.
- · Insert components with leads into the board after fixing the board with support pins or a dedicated jig.
- · Support the bottom side of the board to avoid bending the board.
- · Check the status of the height of each support pin regularly when the support pins are used.

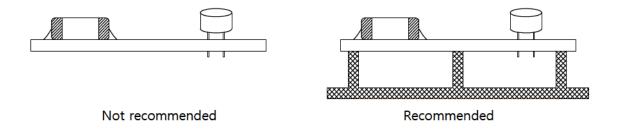



4-10-4. Socket and / or connector attach / detach

Since the insertion or removal from sockets and connectors may cause the board to bent, make sure that MLCC mounted on the board should not be damaged in this process.



4-10-5. Fastening screw

When attaching a shield on a board, the board may be bent during a screw tightening work

Pay attention to the following conditions before performing the work.

- · Plan the work to prevent the board from bending
- · Use a torque driver to prevent over-tightening of the screw.
- · Since the board may be bent by soldering, use caution in tightening the screw.

4-11. Adhesive selection

Pay attention to the following if an adhesive is used to position MLCC on the board before soldering.

4-11-1. Requirements for Adhesives

- They must have enough adhesive strength to prevent MLCC from slipping or moving during the handling the board.
- · They must maintain their adhesive strength when exposed to soldering temperatures.
- · They should not spread when applied to the PCB.
- · They should have a long pot life.
- · They should hardened quickly.
- · They should not corrode the board or MLCC materials.
- · They should be an insulator type that does not affect the characteristic of MLCC.
- · They should be non-toxic, not harmful, and particularly safe when workers touch the adhesives.

4-11-2. Caution before Applying Adhesive

Check the correct application conditions before attaching MLCC to the board with an adhesive. If the dimension of land, the type of adhesives, the amount of coating, the contact surface areas, the curing temperature, or other conditions are not appropriate, it may degrade the MLCC performance.



4-11-3. Cautions for selecting Adhesive

Depending on the type of the chosen adhesive, MLCC insulation resistance may be degraded. In addition, MLCC may be cracked by the difference in contractile stress caused by the different contraction rate between MLCC and the adhesive.

4-11-4. Cautions for the amount of applied adhesive and curing temperature

- The inappropriate amount of the adhesive cause the weak adhesive strength, resulting in the a mounting defect in MLCC
- · Excessive use of the adhesive may cause a soldering defect, loss of electrical connection, incorrect curing, or slippage of a mounting position, thereby an inflow of the adhesive onto a land section should be avoided.
- · If the curing temperature is too high or the curing time is too long, the adhesive strength will be degraded. In addition, oxidation both on the outer termination (Sn) of MLCC and the surface of the board may deteriorate the solderability.

4-12. Flux

- 4-12-1. The excessive amount of flux generates excessive flux gases which may deteriorate solderability.

 Therefore, apply the flux thin and evenly as a whole.
- 4-12-2. Flux with a high ratio of halogen may oxidize the outer termination of MLCC, if cleaning is not done properly. Therefore, use flux with a halogen content of 0.1% max.
- 4-12-3. Strong acidic flux can degrade the MLCC performance
- 4-12-4. Check the solder quality of MLCC and the amount of remaining flux surrounding MLCC after the mounting process.

4-13. Coating

4-13-1. Crack caused by Coating

A crack may be caused in the MLCC due to amount of the resin and stress of thermal contraction of the resin during coating process.

During the coating process, the amount of resin and the stress of thermal contraction of the resin may cause cracks in MLCC

The difference of thermal expansion coefficient between the coating, or a molding resin may cause destruction, deterioration of insulation resistance or dielectric breakdown of MLCC such as cracks or detachment, etc.



4-13-2. Recommended Coating material

- · A thermal expansion coefficient should be as close to that of MLCC as possible.
- · A silicone resin can be used as an under-coating to buffer the stress.
- · The resin should have a minimum curing contraction rate.
- · The resin should have a minimum sensitivity (ex. Epoxy resin).
- The insulation resistance of MLCC can be deteriorated if a high hygroscopic property resin is used in a high humidity condition.
- Do not use strong acid substances due to the fact that coating materials inducing a family of halogen substances and organic acid may corrode MLCC.



5. Design

5-1. Circuit design

When the board is dropped or bent, MLCC mounted on the board may be short-circuited by the drop in insulation resistance. Therefore, it is required to install safety equipment such as a fuse to prevent additional accidents when MLCC is short-circuited, otherwise, electric short and fire may occur. This product is not a safety guaranteed product...

5-2. PCB Design

5-2-1. Unlike lead type components, SMD type components that are designed to be mounted directly on the board are fragile to the stress. In addition, they are more sensitive to mechanical and thermal stress than lead type components.

5-2-2. MLCC crack by PCB material type

A great difference of the thermal expansion coefficient between PCB and MLCC causes thermal expansion and contraction, resulting in cracks in MLCC. Even though MLCC is mounted on a board with a fluorine resin or on a single-layered glass epoxy, cracks in MLCC may occur.


5-3. Design system evaluation


- 5-3-1. Evaluate the actual design with MLCC to make sure there is no functional issue or violation of specifications of the finished goods.
- 5-3-2. Please note that the capacitance may differ based on the operating condition of the actual system since Class 2 MLCC capacitance varies with applied voltage and temperature.
- 5-3-3. Surge resistance must be evaluated since the excessive surge caused by the inductance of the actual system may apply to MLCC.
- 5-3-4. Note the actual MLCC size and the termination shape.



5-4 Land dimension

The recommended land dimension is determined by evaluating the actual SET and a board.

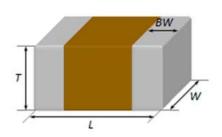

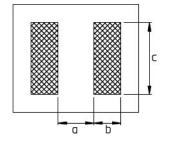

Reflow Footprint

Chip Size [mm]	Chip Tol. [mm]	a [mm]	b [mm]	c [mm]	(a+2b) min	(a+2b) max
0402	± 0.02	0.14~0.20	0.14~0.22	0.20~0.26	0.42	0.64
	± 0.03	0.16~0.20	0.24~0.32	0.30~0.35	0.64	0.84
0603	± 0.05	0.18~0.26	0.24~0.32	0.32~0.37	0.66	0.9
0003	± 0.07	0.20~0.28	0.25~0.35	0.35~0.39	0.7	0.98
	± 0.09	0.22~0.30	0.25~0.35	0.35~0.39	0.72	1
	± 0.05	0.35~0.40	0.37~0.47	0.50~0.55	1.09	1.34
	± 0.07	0.37~0.42	0.37~0.47	0.52~0.58	1.11	1.36
	± 0.10	0.40~0.45	0.37~0.47	0.55~0.60	1.14	1.39
1005	± 0.15	0.40~0.45	0.40~0.50	0.60~0.65	1.2	1.45
	± 0.20	0.45~0.50	0.40~0.50	0.65~0.70	1.25	1.5
	± 0.30	0.45~0.50	0.42~0.52	0.70~0.75	1.29	1.54
	± 0.40	0.50~0.55	0.45~0.55	0.75~0.80	1.4	1.65
	± 0.10	0.50~0.55	0.60~0.65	0.80~0.85	1.7	1.85
	± 0.15	0.55~0.60	0.62~0.67	0.85~0.90	1.79	1.94
1608	± 0.20	0.60~0.65	0.65~0.70	0.90~0.95	1.9	2.05
	± 0.25	0.65~0.70	0.70~0.75	0.95~1.00	2.05	2.2
	± 0.30	0.70~0.75	0.75~0.80	1.00~1.05	2.2	2.35
	±0.10	0.70~0.75	0.75~0.80	1.25~1.30	2.2	2.35
	±0.15	0.75~0.80	0.80~0.85	1.30~1.35	2.35	2.5
2012	±0.20	0.80~0.85	0.85~0.90	1.35~1.40	2.5	2.65
	±0.25	0.85~0.90	0.95~1.00	1.40~1.45	2.75	2.9
	±0.30	0.90~0.95	1.05~1.10	1.45~1.50	3	3.15
3216	±0.20	1.70~1.90	0.85~1.00	1.60~1.80	3.4	3.9
3210	±0.30	1.80~2.00	0.95~1.10	1.70~1.90	3.7	4.2
3225	-	2.00~2.40	1.00~1.40	1.80~2.20	4	5.2
4532	-	2.80~3.20	1.40~1.80	2.40~3.00	5.6	6.8
5750	-	4.00~4.60	1.70~2.30	4.10~4.90	7.4	9.2

Flow Footprint

Chip Size	Chip Tol.	а	b	С	(a+2b)	(a+2b)
[mm]	[mm]	[mm]	[mm]	[mm]	min	max
1608	-	0.60~1.00	0.60~0.80	0.60~0.80	1.8	2.6
2012	-	1.00~1.20	0.80~1.20	0.80~1.20	2.6	3.6
3216	-	2.00~2.40	1.00~1.20	1.00~1.40	4.0	4.8



6. Others

6-1. Storage environment

6-1-1. Recommendation for temperature/humidity

Even taping and packaging materials are designed to endure a long-term storage, they should be stored with a temperature of $0\sim40^{\circ}$ C and an RH of $0\sim70\%$ otherwise, too high temperatures or humidity may deteriorate the quality of the product rapidly.

As oxidization is accelerated when relative humidity is above 70%RH, the lower the humidity is, the better the solderability is.

As the temperature difference may cause dew condensation during the storage of the product, it is a must to maintain a temperature control environment

6-1-2. Shelf Life

An allowable storage period should be within 6 months from the outgoing date of delivery in consideration of solderability. As for products in storage over 6 months, please check solderability before use.

6-2. Caution for corrosive environment

As corrosive gases may deteriorate the solderability of MLCC outer termination, it is a must to store MLCC in an environment without gases. MLCC that is exposed to corrosive gases may cause its quality issues due to the corrosion of plating layers and the penetration of moisture.

6-3. Equipment in operation

- 6-3-1. Do not touch MLCC directly with bare hands to prevent an electric shock or damage.
- 6-3-2. The termination of MLCC shall not be contacted with a conductive object (short –circuit).

 Do not expose MLCC to conductive liquid containing acidic or alkaline material.
- 6-3-3. Do not use the equipment in the following conditions.



- (1) Exposure to water or oil
- (2) Exposure to direct sunlight
- (3) Exposure to Ozone or ultra-violet radiation.
- (4) Exposure to corrosive gas (e.g. hydrogen sulfide, sulfur dioxide, chlorine, ammonia gas)
- (5) Exposure to vibration or mechanical shock exceeding specified limit
- (6) Exposure to high humidity
- 6-3-4. If the equipment starts generating any smoke, fire or smell, immediately switch it off or unplug from the power source.

If the equipment is not switched off or unplugged, serious damage may occur due to the continuous power supply. Please be careful with the high temperature in this condition.

6-4. Waste treatment

In case of scrapping MLCC, it is incinerated or buried by a licensed industrial waste company. When scrapping MLCC, it is recommended to incinerate or bury the scrappage by a licensed industrial waste company.

6-5. Operating temperature

The operating temperature limit is determined by the specification of each models.

- 6-5-1. Do not use MLCC over the maximum operating temperature.

 Pay attention to equipment's temperature distribution and the seasonal fluctuation of ambient temperature.
- 6-5-2. The surface temperature of MLCC cannot exceed the maximum operating temperature including self-heating effects.

6-6. Transportation

The performance of MLCC may be affected by transportation conditions.



6-6-1. MLCC shall be protected from excessive temperature, humidity and a mechanical force during transportation.

During transportation, the cartons shall not be deformed and the inner packaging shall be protected from excessive external forces.

- 6-6-2. Do not apply excessive vibrations, shocks or excessive forces to MLCC.
 - · If excessive mechanical shock or stress are applied, MLCC's ceramic body may crack.
 - · When the surface of MLCC is hit with the sharp edge of an air driver, a soldering iron, or a tweezer, etc, MLCC may crack or become short-circuited.
- 6-6-3. MLCC may crack and become non-functional due to the excessive shocks or dropping during transportation.

6-7. Notice

Some special products are excluded from this document.

Please be advised that this is a standard product specification for a reference only.

We may change, modify or discontinue the product specifications without notice at any time.

So, you need to approve the product specifications before placing an order.

Should you have any question regarding the product specifications,

please contact our sales personnel or application engineers.



Caution of Application

Disclaimer & Limitation of Use and Application

The products listed in this Specification sheet are NOT designed and manufactured for any use and applications set forth below.

Please note that any misuse of the products deviating from products specifications or information provided in this Spec sheet may cause serious property damages or personal injury.

We will NOT be liable for any damages resulting from any misuse of the products, specifically including using the products for high reliability applications as listed below.

If you have any questions regarding this 'Limitation of Use and Application', you should first contact our sales personnel or application engineers.

- ① Aerospace/Aviation equipment
- ② Medical equipment
- 3 Military equipment
- 4 Disaster prevention/crime prevention equipment
- ⑤ Power plant control equipment
- 6 Atomic energy-related equipment
- 7) Undersea equipment
- 8 Traffic signal equipment
- 9 Data-processing equipment
- 10 Electric heating apparatus, burning equipment
- (II) Safety equipment
- ② Any other applications with the same as or similar complexity or reliability to the applications